Precision Automotive Multi Point inspection

PRECISION AUTOMOTIVE
13867 POWAY RD
POWAY, CA 92064
(858) 486-4444

[redacted]
2019 HONDA ODYSSEY EX-L
[redacted]
Odometer: 110393

Passed

HORN

Headlight Condition

OUTSIDE LIGHTS

AC Temp Vent

AIR FILTER



ENGINE OIL

Technician Note: Here today for service

TRANSMISSION FLUID

Technician Note: Serviced 6/2024 71,436 miles per carfax record

[redacted]

Recommendation: Due service every 36000 miles drain and fill

BRAKE FLUID

Technician Note: Serviced 10/2024 here

ANTI-FREEZE


Technician Note: Serviced 6/2024 71,436 per carfax record

RADIATOR HOSES



RADIATOR

BATTERY

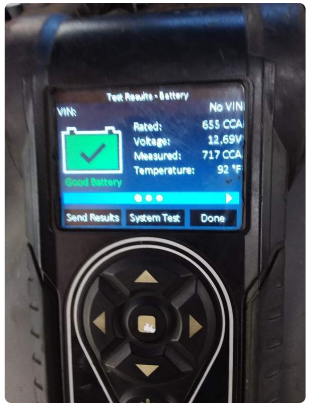


UPPER AND LOWER ENGINE COVERS

[redacted]

STRUTS AND SHOCKS

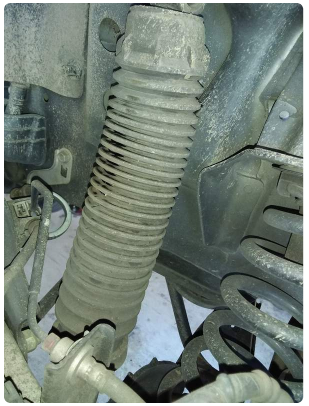

CV BOOTS AND AXLES

ENGINE AND TRANSMISSION MOUNTS

FLUID LEAKS

Parking Brake

ALIGNMENT

TIRES

Technician Note: FRONT TIRE TREAD 8 /32 inch remianing REAR TIRE TREAD 8 /32 inch remaining

TIRE PRESSURE CHECK

Technician Note: Front Tires Set to ____35_ PSI Rear Tires Set to __35____PSI

Non-Urgent

STEERING AND SUSPENSION

Technician Note: Front lower control arm bushings beginning to tear

Recommendation: Monitor with oil changes

[redacted]






Urgent

DASH LIGHTS

Technician Note: Adaptive cruise control problem Collision Mitigation system problem Auto high beam problem Brake System warning Maintenance due soon B1245

Recommendation: Safety systems are likely disabled Initial Testing on Faults $225

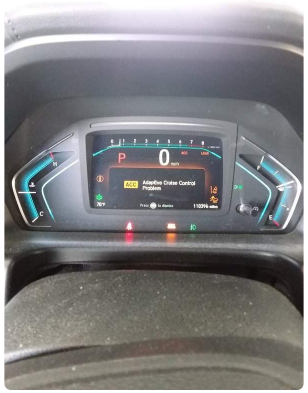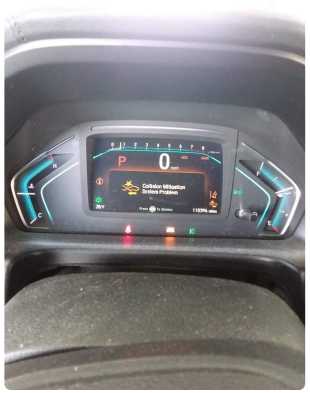
WIPER BLADES

Technician Note: The rear wiper is streaking and should be replaced

Recommendation: Replace Rear Wiper

CABIN AIR FILTER

Technician Note: Cabin Air Filter - Dirty and need to be replaced. Due per A2 Service

[redacted]

Recommendation: Cabin Air Filter - is dirty and needs to be replaced



TIMING BELT

Technician Note: Due per Maintenance code A4 No service history in carfax report

Recommendation: Replace timing belt with water pump, tensioner, idler, camshaft and crankshaft seals with drive belt

SPARK PLUG & WIRES

Technician Note: Due per Maintenance code A4 No service history in carfax report

Recommendation: Replace spark plugs

FRONT BRAKES

Technician Note: Front Brake Pads - Low pad ____mm remaining FRONT ROTOR MIN THICKNESS _____1.024__ FRONT ROTOR ACTUAL THICKNESS ____L __1.058__R 1.057

Recommendation: Replace Brake Pads and Re-surface Rotors

[redacted]



REAR BRAKES

Technician Note: Rear Brake Pads - Measures _4___ MM Remaining Rear Rotor Thickness Measures ____L .390 R .393 _ Rear Rotor Minimum Machining __.354___

Recommendation: Replace Rear Pads and Re-Surface Rotors

Report Prepared On 9/22/2026

©2026 BOLT ON TECHNOLOGY